

# Input / Output Signals


**PLEASE PAY ATTENTION TO THE CONNECTIONS BETWEEN OUTPUT SIGNALS OF THE MOTOR AND THE PLC!**

**OUTPUTS ARE NOT PROTECTED AGAINST EXCESSIVE CURRENT REQUEST (MAX 100mA).**

**IF THE OUTPUTS WILL BE CONNECTED TO GROUND OR LOW RESISTANCE LOAD WHEN THE MOTOR IS ENABLED THE OUTPUT PNP TRANSISTOR WILL BE DAMAGED PERMANENTLY.**

## Input signals

The inputs are protected from inversion and overvoltage. The logic level is 24VDC.

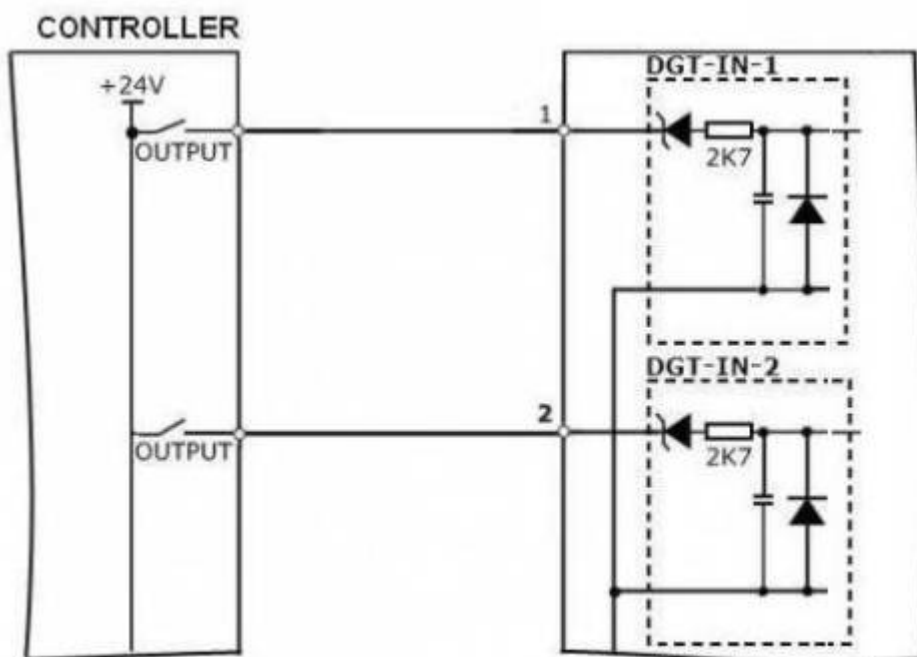


## Output Signals


### PNP - Default type (Default type - With 24VDC drive)

The digital output signals are by default PNP type (without internal pull-down).  
The absolute current capability is **100mA per output line**.

**FOR CORRECT OPERATION TO AVOID DAMAGE, USE TYPE 2, EN 61131-2 INPUT CHARACTERISTIC CURVE ON THE PLC INPUT.**  
**IN THIS CASE THE CURRENT DRAW FROM THE PLC INPUTS IS TYPICALLY < 10mA**

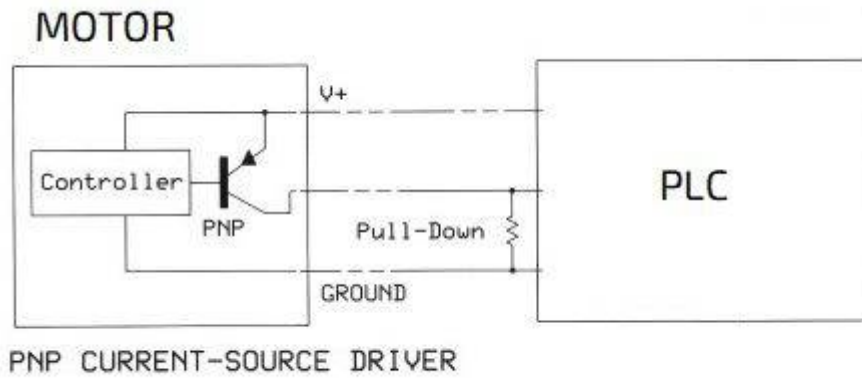

## NPN Type - 48VDC compatible drive

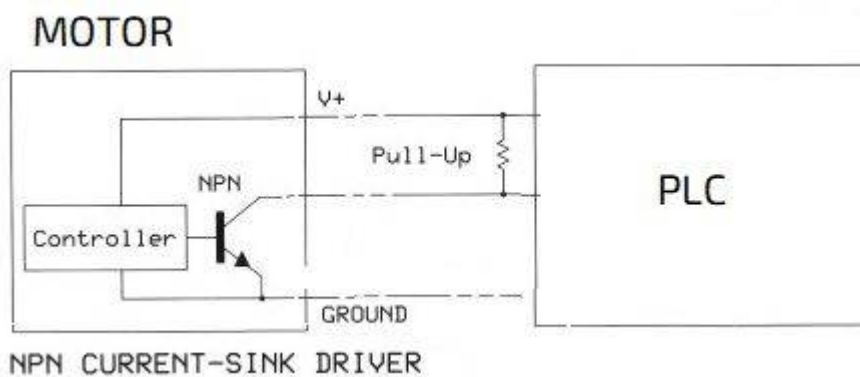

From:

<https://www.nilab.at/dokuwiki/> - NiLAB GmbH  
**Knowledgebase**

Permanent link:

[https://www.nilab.at/dokuwiki/doku.php?id=en:gdi\\_iso\\_integrated:outputs](https://www.nilab.at/dokuwiki/doku.php?id=en:gdi_iso_integrated:outputs)

Last update: **2026/09/11 07:54**

